

EC Declaration of Conformity

MANUFACTURER : *YILMAZ MACHINERY INDUSTRY &TRADE CO*
Taşdelen Mh. Atabey Cd. No9 Cekmeköy-ISTANBUL- TURKIYE

tel: +90 0216 312 2828 fax: +90 0216 484 42 88
yilmaz@yilmazmachine.com.tr

Declare on our own responsibility that ;

ACK 420 SINGLE HEAD MITRE SAW



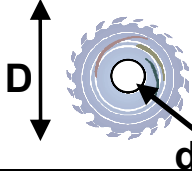

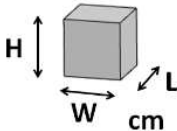


SERIAL NO;



Meets all the provisions of the 2006/42 EC Machinery Directive, 2014/35 EU Low Voltage Directive, and 2014/30 EU EMC Directive which apply to it

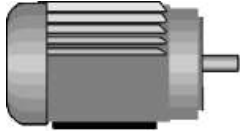

Place / Date

Authorized


TEKNİK ÖZELLİKLER - TECHNICAL FEATURES - ТЕХНИЧЕСКИЕ ОСОБЕННОСТИ

								
ACK 420	2.2 kW 50 Hz 400 V AC 3 P PE	3000 D/dak. RPM	D = 420 mm d = 30-32 mm	6/8 Bar	34 Lt/dak Lt/min	W = 85 L = 95 H = 145	210 kg	260 kg

 YILMAZ MAKİNE SANAYİ VE TİCARET A.Ş. Taşdelen Mh. Atabey Cd. No 9 34788 Cekmekoy İSTANBUL-TURKIYE Tel: +90 (216) 312 28 28 (Pbx) Fax: +90 (216) 484 42 88 web : www.yilmazmachine.com.tr e-mail: yilmaz@yilmazmachine.com.tr					
MODEL TYPE MODEL	ACK 420	RATED CURRENT NOMINAL AKIM	4,7 A		
SERIAL NO SERI NO		SAW DIAMETER TESTERE ÇAPı	Ø420xØ30/32mm		
PROD. DATE ÜRETİM TAR.		AIR CONSUMP. HAVA TÜKETİMİ	34 Lt / min		
TOTAL POWER TOPLAM GÜÇ	2240 W	AIR PRESSURE HAVA BASINCI	6-8 BAR		
RATED VOLTAGE NOMİNAL GERİLİM	400V AC 3P PE	WEIGHT AĞIRLIK	210 KG.		

 YILMAZ MAKİNE SANAYİ VE TİCARET A.Ş. Taşdelen Mh. Atabey Cd. No 9 34788 Cekmekoy İSTANBUL-TURKIYE Tel: +90 (216) 312 28 28 (Pbx) Fax: +90 (216) 484 42 88 web : www.yilmazmachine.com.tr e-mail: yilmaz@yilmazmachine.com.tr					
MODEL TYPE MODEL	ACK 420	RATED CURRENT NOMINAL AKIM	15,2 A		
SERIAL NO SERI NO		SAW DIAMETER TESTERE ÇAPı	Ø420xØ30/32mm		
PROD. DATE ÜRETİM TAR.		AIR CONSUMP. HAVA TÜKETİMİ	34 Lt / min		
TOTAL POWER TOPLAM GÜÇ	2240 W	AIR PRESSURE HAVA BASINCI	6-8 BAR		
RATED VOLTAGE NOMİNAL GERİLİM	230V AC P N PE	WEIGHT AĞIRLIK	210 KG.		

BOYUTLAR – DIMENSIONS – РАЗМЕРЫ

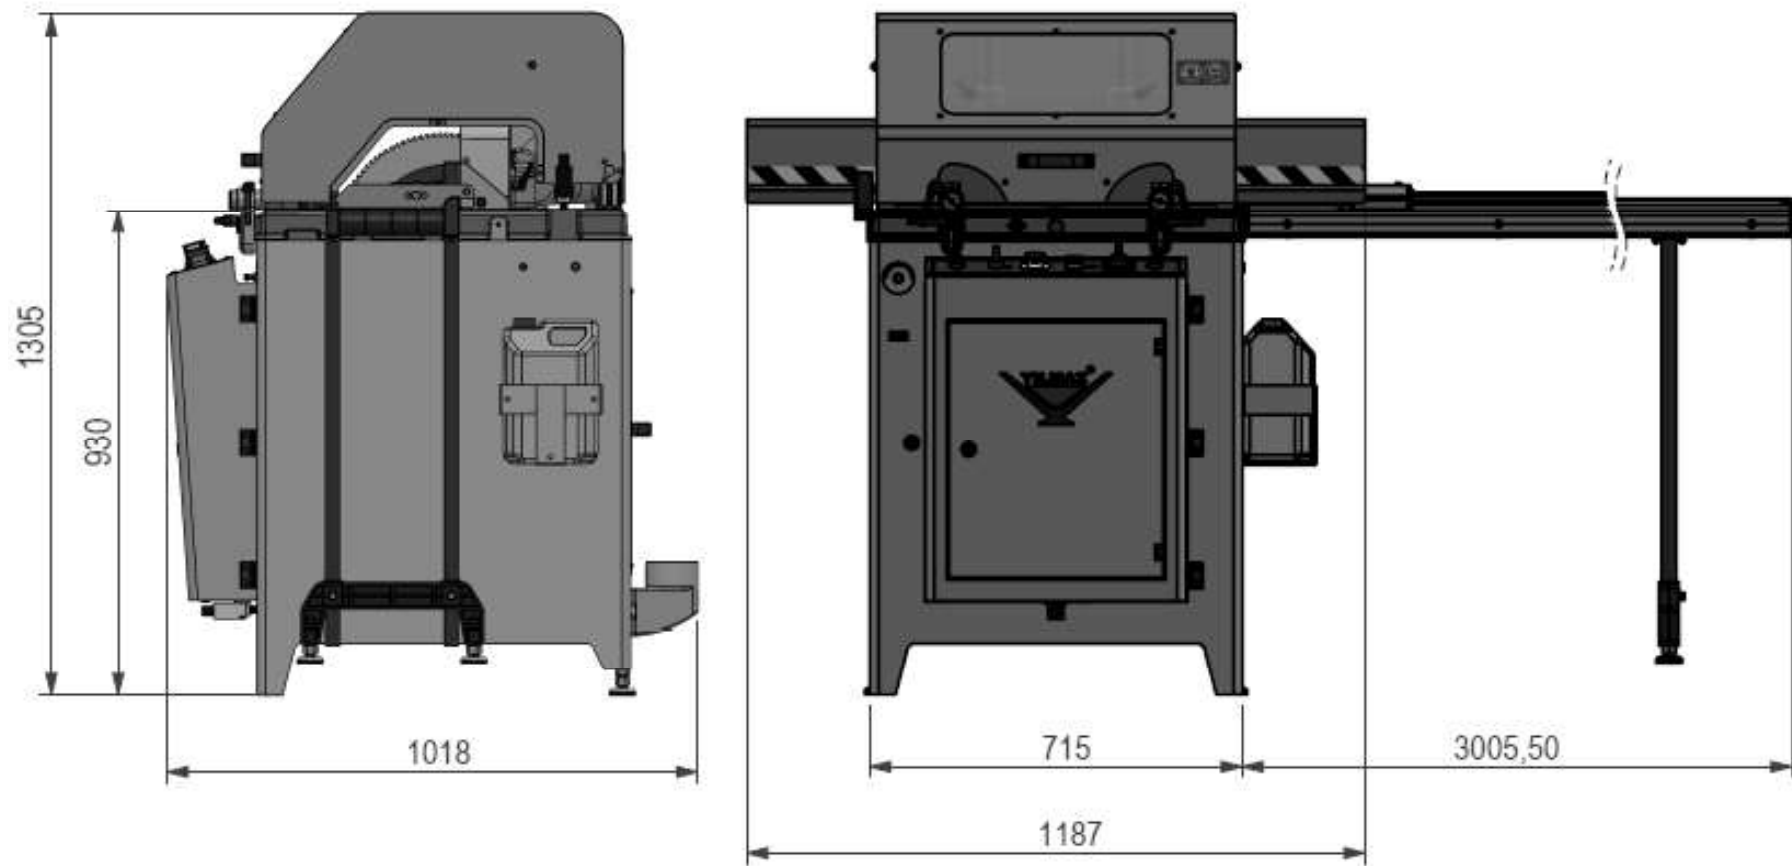


KESME DİYAGRAMI – CUTTING DIAGRAM - ДИАГРАММА РЕЗКИ

ACK 420 (Ø420 MM)


mm.

- 90°
- 45°
- 60°
- 75°

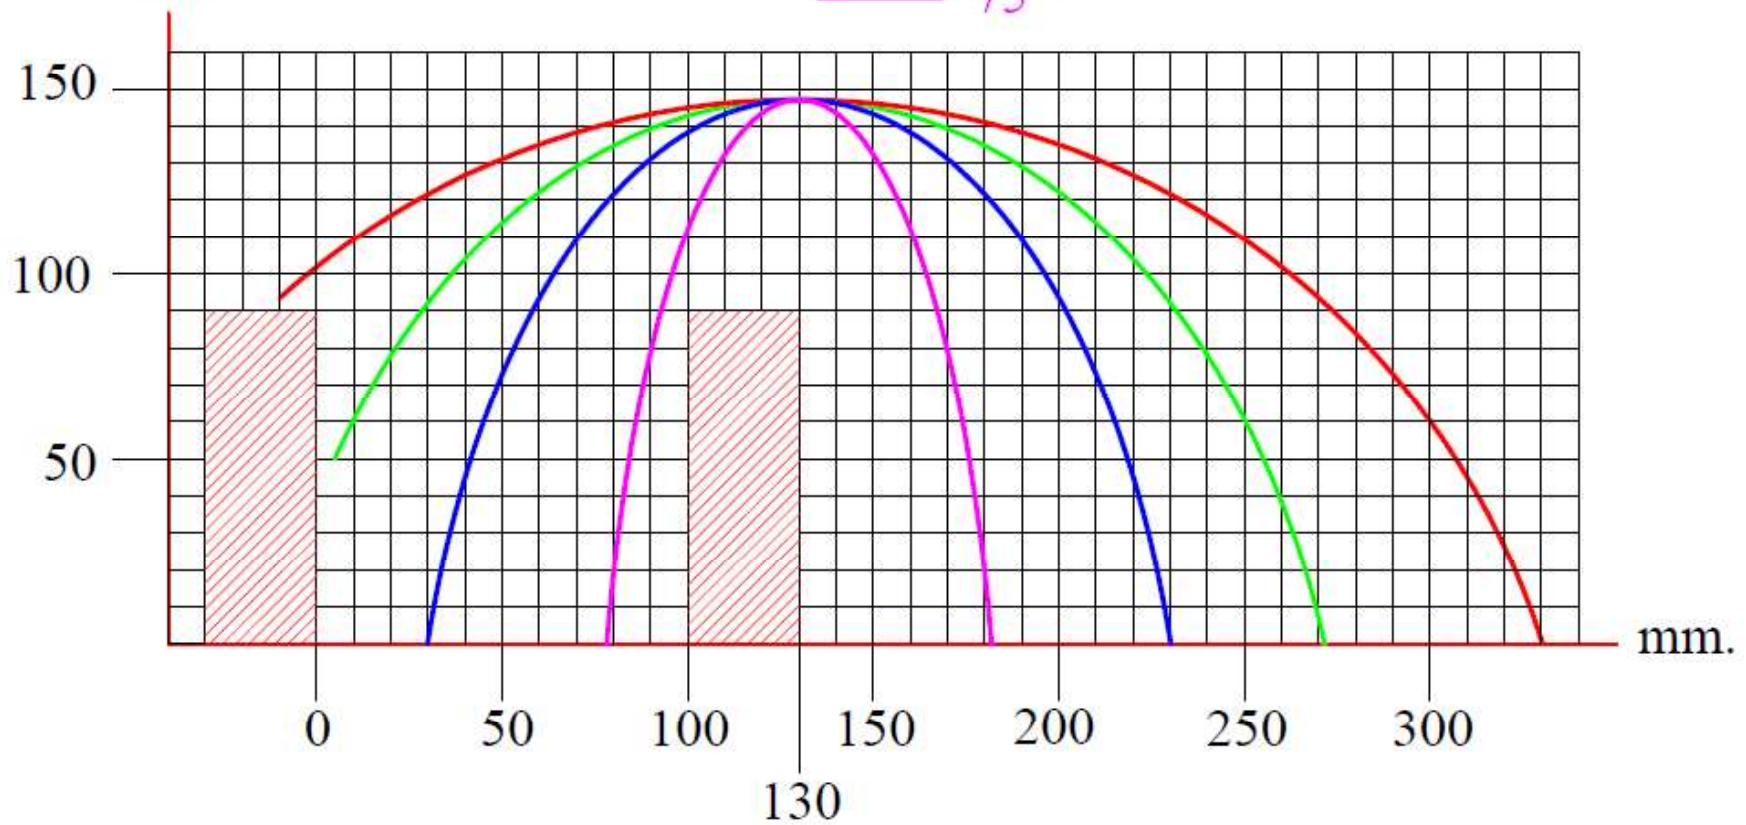



PARÇA LİSTESİ - PART LIST - ПЕРЕЧЕНЬ ДЕТАЛЕЙ

RESİM-FIGURE-РИСУНОК 1

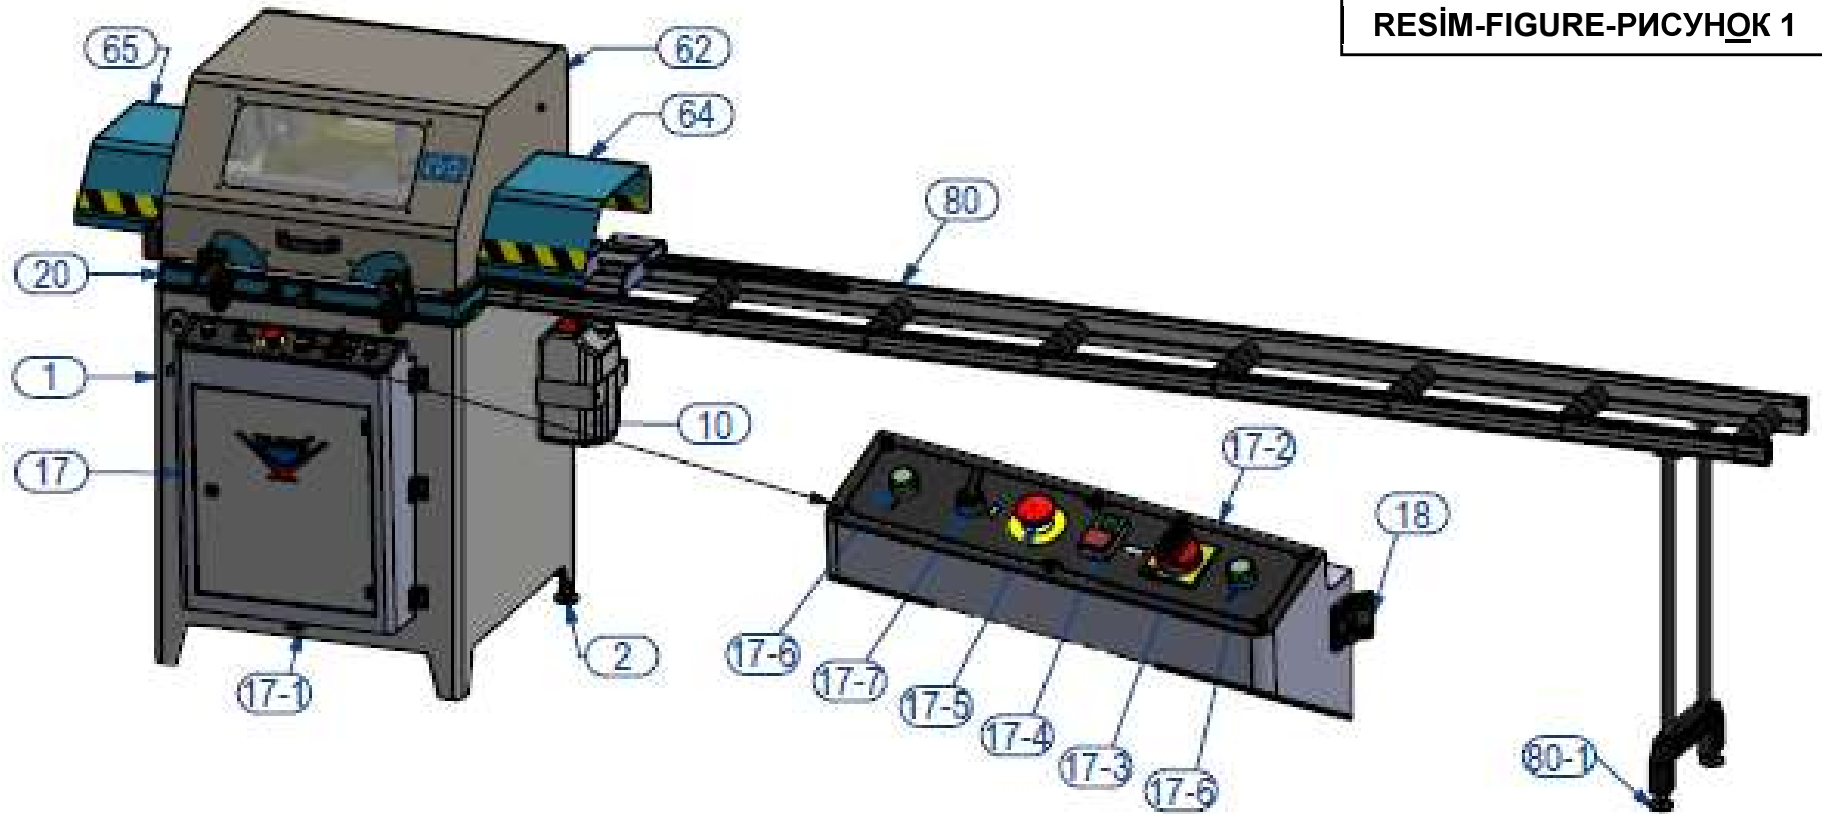

RESİM-FIGURE-РИСУНОК 2

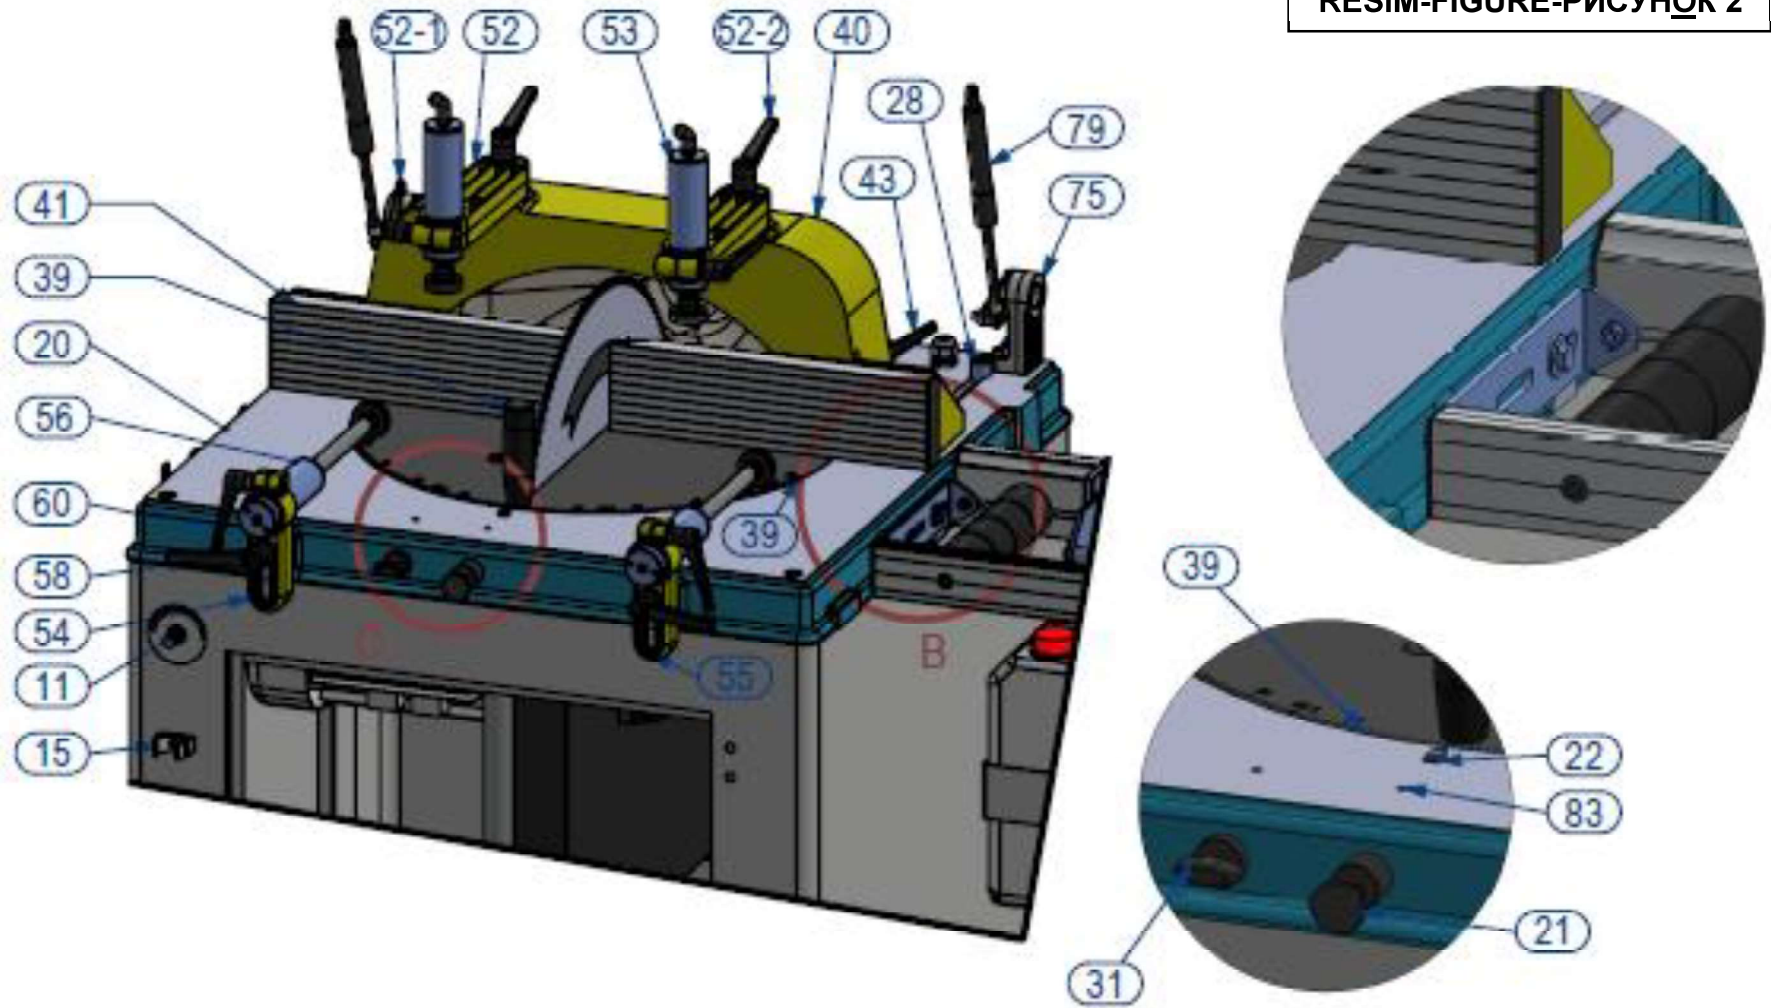

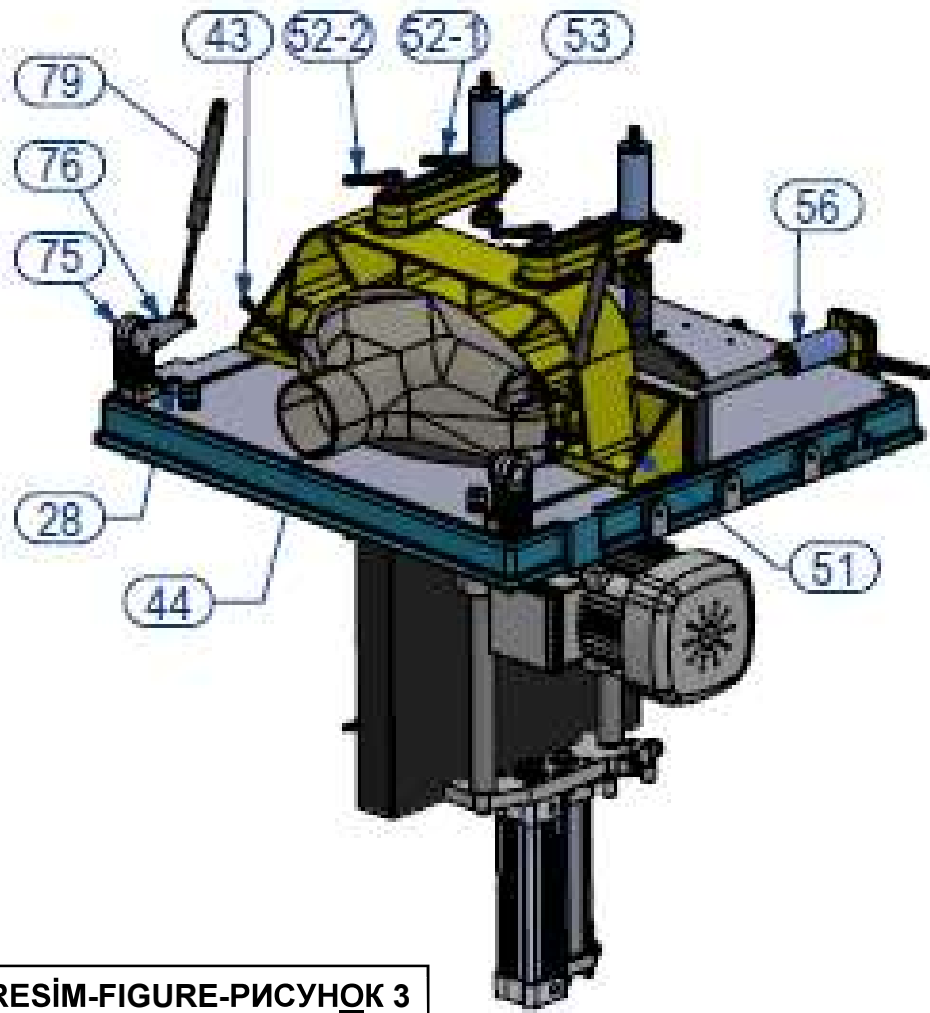


RESİM-FIGURE-РИСУНОК 3

NO номер	СТОК КОДУ STOCK CODE ПОРЯДОК КОД	АДЕТ QTY КОЛИЧЕСТВО	NO номер	СТОК КОДУ STOCK CODE ПОРЯДОК КОД	АДЕТ QTY КОЛИЧЕСТВО
1	1SA010000-0091	1	40	2TU012510-0573	1
2	1SC170000-0007	2	41	2TU012310-0007	2
10	* 1PL010000-0019	1	43	3UA040030-0011	2
11	1HD050000-0001	1	44	2TU012510-0557	1
15	1PL050000-0035	1	52	2TU012610-0044	2
17	3UA120030-0200	1	53	3UA060030-0004	2
17-1	1EL020000-0005	2	54	2TU012610-0010	1
17-2	2ET022441-0090	1	55	2TU012610-0054	1
17-3	1EL010000-0046	1	56	* 3UA060030-0017	2
17-4	1EL090000-0016	1	58	3UA040030-0002	2
17-5	1EL090000-0001	1	60	3UA040030-0017	2
17-6	1EL090000-0009	2	62	1SA030000-0131	1
17-7	1PN010000-0055	1	64	1SA030000-0131-1	1
18	1SC140000-0002	3	65	1SA030000-0131-2	1
20	2TU012550-0556	1	69	1EL020000-0005	1
21	3UA030030-0008	1	75	2TU012510-0574	2
22	2TU011441-0017	1	76	2TU011441-1107	2
28	2TU011110-0024	2	79	1YY030000-0013	2

31	2TU011110-0144	1	80	4UN300030-0001	1
39	1PL010000-0103	1			

* OPSİYONEL / OPTIONAL / ДОПОЛНИТЕЛЬНЫЕ


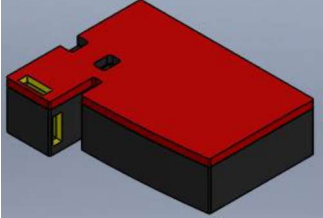
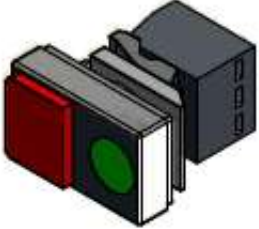

RESİM-FIGURE-ПИСУНОК 4

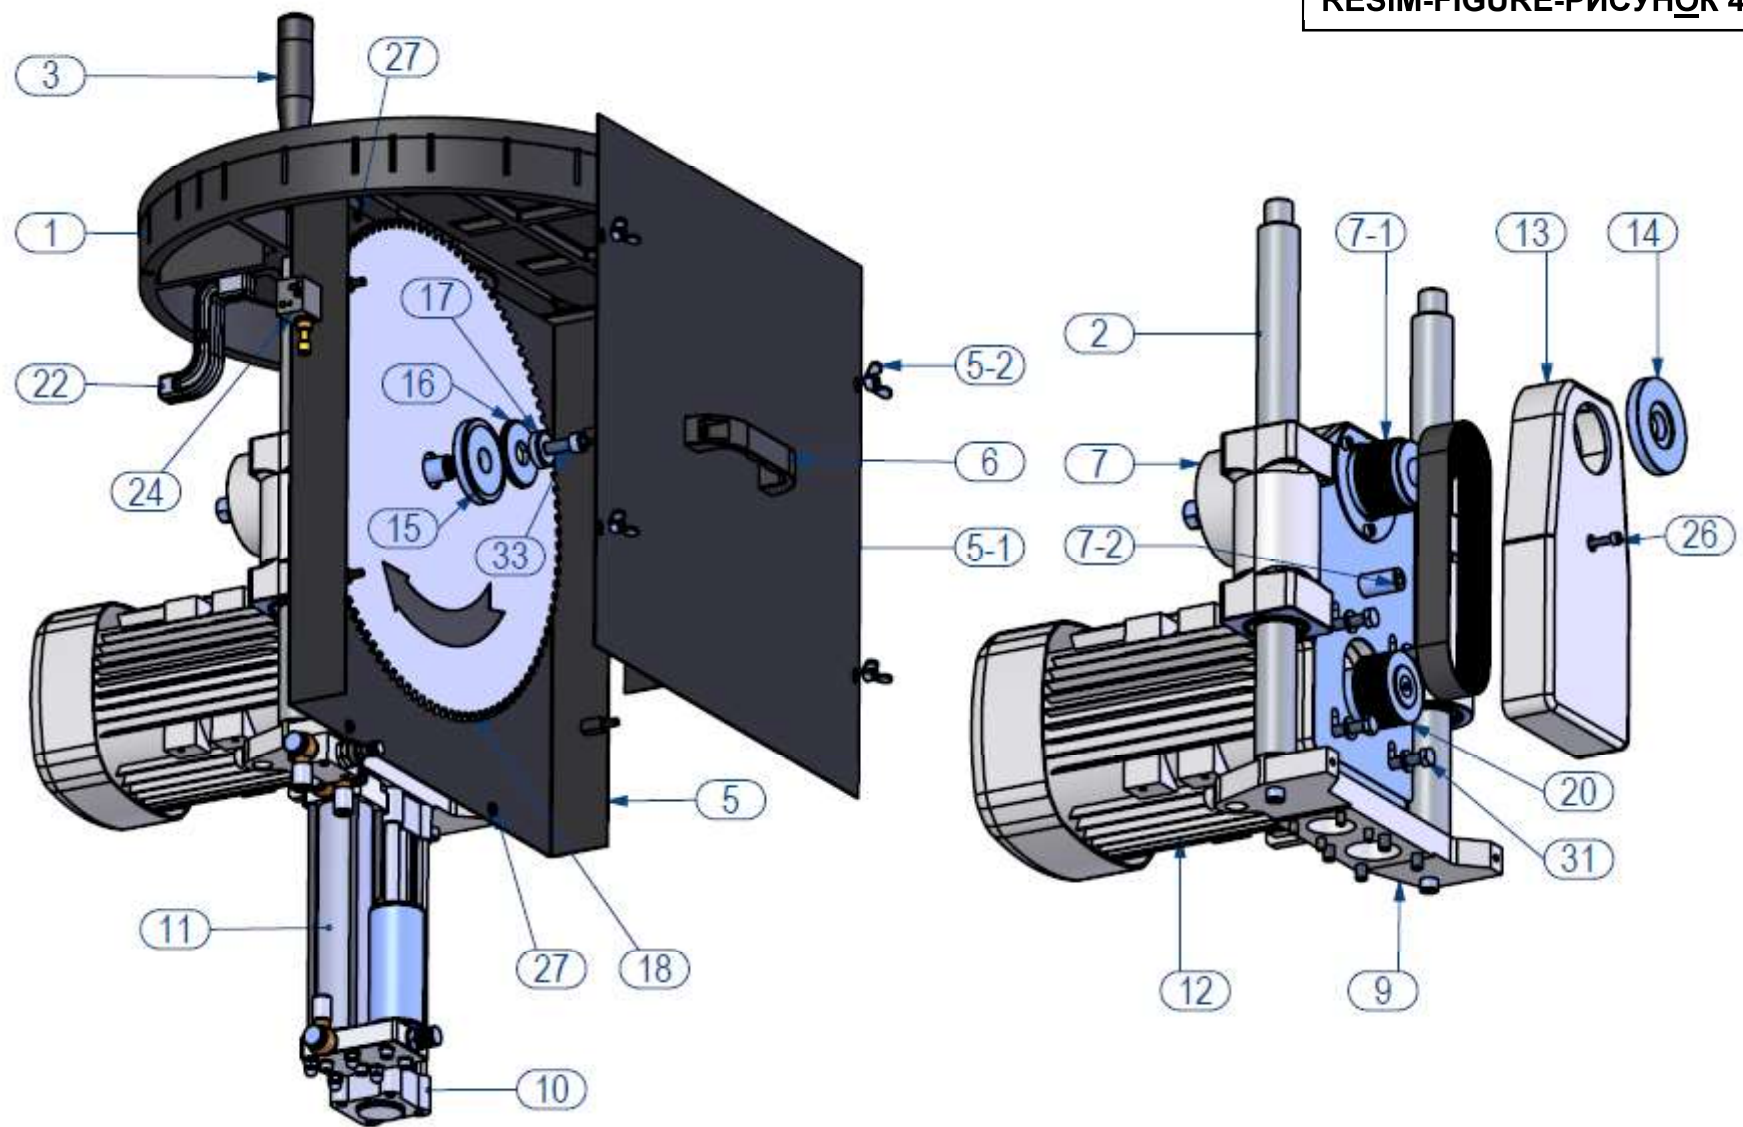

NO номер	STOK KODU STOCK CODE ПОРЯДОК КОД	ADET QTY КОЛИЧЕСТВО	NO номер	STOK KODU STOCK CODE ПОРЯДОК КОД	ADET QTY КОЛИЧЕСТВО
1	2TU011610-0015	1	14	2TU011110-0422	1
2	2TU015010-0053	2	15	2TU011110-0423	1
3	1PL010000-0103	1	16	2TU011441-0016	1
4	2TU011210-0291	2	17	2TU011110-0488	1
5	1SA050000-0003	1	18	1SK010000-0074	1
6	1PL010000-0016	1	19	1SR070000-0015	1
7	2TU012510-0274	1	20	2TU012110-0011	1
7-1	2TU011110-0476	2	21	2TU011110-0010	1
7-2	2TU011110-1027	1	22	2TU012510-0574-0	2
8	2TU011210-0106	1	24	*1PN010000-0012	1
9	2TU012510-0204	1	26	1SC021000-0008	7
10	1PN020000-0007	1	27	1SC041000-0011	4
11	3UA050030-0001	1	31	1SC011000-0018	4
12	1EL070001-0001	1	33	1SC021000-0003	1
13	2TU012510-0203	1			

* OPSİYONEL / OPTIONAL / ДОПОЛНИТЕЛЬНЫЕ




YEDEK PARÇA LİSTESİ / SPARE PART LIST / СПИСОК ЗАПАСНЫХ ЧАСТЕЙ

PARÇA NO PART NO НОМЕР	RESİM FIGURE РИСУНОК	STOK KODU / CODE ПОРЯДОК КОД	PARÇA ADI – PART NAME НАИМЕНОВАНИЕ ДЕТАЛИ
17-1		1EL020000-0005	KAPAK SWITCH COVER SWITCH
		1EL020000-0025	KAPAK SWITCH (CE) COVER SWITCH (CE)
17-4		1EL090000-0017	ŞALTER SWITCH
17-5		1EL090000-0001	XB4-BS8442 ACİL STOP BUTONU EMERGENCY STOP BUTTON

17-7		1PN010000-0055	MENGENE BUTONU CLAMP BUTTON
17-6		1EL090000-0009	BUTON BUTTON
17-3		1EL010000-0046	ANA ŞALTER MAIN SWITCH
41		2TU012310-0007	HAREKETLİ GÖNYE MOVING SETSQUARE
52		2TU012610-0044	MENGENE YATAĞI CLAMP MOUNTING BRACKET

53		3UA046030-0004	PNÖMATİK MENGENE PNEUMATIC CLAMP
		1PL010000-0033	MENGENE PABUCU CLAMP FEET
10		1PN020000-0007	PİSTON (PNY-AY 50x160) PISTON (PNY-AY 50x160)
11		3UA050030-0001	HİDROÇEK ÜNİTESİ HYDROCONTROL UNIT
79		1YY030000-0013	AMORTİSÖR SHOCK ABSORVER
		3UA110030-0020	ŞARTLANDIRICI LUBRICATOR

24		1PN010000-0012	SPRAYER SU PÜSKÜRTME VALF WATER SPRAY VALVE
		1PN140000-0005	1/8-6 DİRSEK 1/8-6 FITTING
12		1EL070001-0002 (230V-1P 50 Hz) 1EL070001-0017 (240V-1P 50 Hz) 1EL070001-0019 (220V-1P 60 Hz) 1EL070001-0001 (400V-415V 3P 50 Hz) (440V-3P 60 Hz)	MOTOR MOTOR
		1SR070000-0015	MOTOR KAYIŞI MOTOR BELT
18		1SK010000-0074	TESTERE BIÇAĞI SAW BLADE
		1SC140000-0006	MENTEŞE HINGE

52-2		3UA040030-0001	M12*60 PİPO M12*60 HANDLE
52-1		3UA040030-0005	M8*45 PİPO M8*45 HANDLE
		1PL040000-0022	MUHAFAZA CAMI GUARD GLASS

CONTENTS

- 1. General information**
 - 1.1. Introduction
 - 1.2. Service Information
- 2. Safety**
 - 2.1. Safety Symbols and Their Meanings
 - 2.2. Accidents Prevention
 - 2.3. General Safety Information
- 3. Machine's Description**
- 4. Transport of the Machine**
- 5. Installation of the Machine**
 - 5.1. Preparation
 - 5.2. Connecting to Power Source
- 6. Machine's Safety Information**
- 7. Operation**
 - 7.1 Preparation
 - 7.2 Operation
- 8. Maintenance, Service and Repair**
 - 8.1 Maintenance
 - 8.2 Changing the cutting tool
 - 8.3 Changing the belt
 - 8.4 Angular and run out adjustment control of saw blade and set square
 - 8.5 Adjust the air pressure (pneumatic systems)
- 9. Noisy emission values**
- 10. Troubleshooting Guide**
- 11. Warranty conditions**

1. GENERAL INFORMATION

1.1. Introduction

The user's manual given by the manufacturer contains necessary information about the machine parts. Each machine operator should read these instructions carefully, and the machine should be operated after fully understanding them.

Safe and efficient use of the machine for long term depends on understanding and following the instructions contained in this manual. The technical drawings and details contained in this manual constitute a guide for the operator.

1.2. Service Information

In case of any technical problem please contact your nearest YILMAZ dealer, or YILMAZ head office through the above mentioned phone, fax or e-mail address.

Technical labels with the model description of the machine are fixed onto the front side of each machine.

The machine's serial number and manufacturing year are stipulated on the technical label.

Average life usage of production is 10 years. If you have any further failure and complaint, please inform to our below mentioned technical service by verbal or written

AUTHORIZED TECHNICAL SERVICE CENTER ADDRESS

TAŞDELEN MH. ATABEY CD. No 9 34788 ÇEKMEKÖY – İSTANBUL / TÜRKİYE

Tel 0216 312 28 28 Pbx.

Fax 0216 484 42 88

E-mail service@yilmazmachine.com.tr













Web www.yilmazmachine.com.tr

For minimize the documantation, It is wery necessary to mention below details at the agreements signed with suppliers and dealers of the purchased machines

- | | |
|------------------------------------|--|
| • Machine model | • Voltage and frequency |
| • Machine's serial number | • Date of purchase |
| • Description of the machine fault | • Name of dealer where machine was purchased |
| • Average daily operation period | |

2. SAFETY

2.1. Safety Symbols and Their Meanings

	Read the user guide		Ensure safe working position, always keep your balance.
	Wear ear protectors		Elektrical excitation
	Wear safety goggles		Don't place your hands between parts in motion..
	If the power cable should be damaged during operation, don't touch and unplug it. Never use damaged power cables.		High temperature warning
	During saw blade change operations, use protective gloves		Keep your fingers clear of the movable parts of the glide arm.
	The above symbol DANGER WARNING , warns you against specific dangers, and you have definitely to read them..		The IMPORTANT symbol above is one telling to apply special care and to be careful at carrying out the specified operation

2.1. Accidents Prevention



- 2.2.1 Our machines are manufactured in accordance with CE safety directives, which cover national and international safety directives.
- 2.2.2 It is the task of the employer to warn his staff against accident risks, to train them on prevention of accidents, to provide for necessary safety equipment and devices for the operator's safety.
- 2.2.3 It is the task of the employer to warn his staff against accident risks, to train them on prevention of accidents, to provide for necessary safety equipment and devices for the operator's safety.
- 2.2.4 Machine should be operated only by staff members, who have read and understood the contents of this manual.
- 2.2.5 All directives, recommendations and general safety rules contained in this manual have to be observed fully. The machine cannot be operated in any way for purposes other than those described herein. Otherwise, the manufacturer shall not be deemed responsible for any damages or injuries. And such circumstances would lead to the termination of the warranty

2.2. General Safety Information

- 2.3.1 The power cable should be led in such a way that nobody can step on it or nothing can be placed on it. Special care has to be taken regarding the inlet and outlet sockets
- 2.3.2 Don't overload machines for drilling and cutting. Your machine will operate more safely with power supply in accordance with the stipulated values.
- 2.3.3 Use correct illumination for the safety of the operator. (ISO 8995-89 Standard The lighting of indoor work system)

- 2.3.4** Use correct illumination for the safety of the operator. (ISO 8995-89 Standard The lighting of indoor work system)
- 2.3.5** Don't use any materials other than those recommended by the manufacturer for cutting operations on the machine.
- 2.3.6** Ensure that the work piece is clamped appropriately by the machine's clamp or vice
- 2.3.7** Ensure safe working position, always keep your balance.
- 2.3.8** Keep your machine always clean for safe operation. Follow the instructions at maintenance and replacement of accessories. Check the plug and cable regularly. If damaged, let it replace by a qualified electrician. Keep handles and grips free of any oil and grease.
- 2.3.9** Unplug first, before conducting and maintenance works.
- 2.3.10** Ensure that any keys or adjustment tools have been removed before operating the machine..
- 2.3.11** If you are required to operate the machine outside, use only appropriate extension cables.
- 2.3.12** Repairs should be carried out by qualified technicians only. Otherwise, accidents may occur.
- 2.3.13** Before starting a new operation, check the appropriate function of protective devices and tools, ensure that they work properly. All conditions have to be fulfilled in order to ensure proper operation of your machine. Damaged protective parts and equipment have to be replaced or repaired properly (by the manufacturer or dealer).
- 2.3.14** Don't use machines with improper functioning buttons and switches
- 2.3.15** Don't keep flammable, combustive liquids and materials next to the machine and electric connections.

3. MACHINE'S DESCRIPTION

Mitre cutting machines designed for straight and angle cutting of PVC and Aluminium profiles.

- Two hand control system application is available in terms of employee safety.
- Moveable back fences to maximize cut capacity.
- Positive locating pin lock at 0-15° - 22, 5° - 30° - 45° - 60° - 75° intermediate angles set with a table lock.
- Hydro-pneumatic saw blade feed with variable speed control to suit different profiles & materials
- Saw complies with CE Safety Directives

<u>STANDARD ACCESSORIES</u>	<u>OPTIONAL ACCESSORIES</u>
1SK010000-0074 420 mm saw blade	Additional 420 mm saw blade
Air Gun	Cooling system
4UN300030-0001 Conveyor (MKN 300)	3UA060030-0017 Horizontal pneumatic clamps
User's manual	

4. TRANSPORT OF THE MACHINE

IMPORTANT

4.1. The transport should be done by qualified personnel only.

- 4.2. The machine should be transported by lifting with proper equipment (not touching the ground during the transport).
- 4.3. Unless customer requests the contrary, the machine will be delivered with wooden packaging.
- 4.4. Movable parts on the machine should be fixed before carrying out the transport.
- 4.5. The machine size and weight measurements, given the technical specification sheet.

5. INSTALLATION OF THE MACHINE

5.1 Preparation

- 5.1.1 The machine size and weight measurements, given the technical specification sheet. The ground, where the machine will be placed, should be even, solid enough to bear the weight of the machine
- 5.1.2 The machine should be located approx. 100 cm away from the rear wall
- 5.1.3 You can provide the balance of the machine with adjustable counterforts (FIGURE 1 NO.2) in the bottom part.
- 5.1.4 Fasten MKN 300 conveyor (FIGURE 1 NO.80) given as Standard accessory onto the cutting unit to the right side surface of the machine as seen in the FIGURE 1 by using the screws on the machine. Provide the conveyor bobbins and machine top surface to be the same parallelism by using a sensitive and calibrated water gauge.
- 5.1.5 Side protective covers (FIGURE 1 NO.64/65) are sent as demounted. Mount the covers as shown on the figure 1.
- 5.1.6 To use shaving manifolde, the absorption flowrate of air for dry chips has to be thought min.20m/sec. 28 m/sec absorption flowrate of air wet chips ($\geq 18\%$ humidity) can be decided to operate the manifolde

5.2 Connecting to Power Source

- 5.2.1 The Electrical connection must be made by a licensed electrician
- 5.2.2 The power outlet socket on the machine should be available.
- 5.2.3 Plug the machine to a grounded socket.
- 5.2.4 Main voltage of the machine is 400 V 50 Hz.



5.2.5 Check the power source voltage. It has to be in accordance with the values stipulated on the machine's type label.

5.2.6 After electrical connection is made, machine must be operated in idle running and it must be controlled whether rotation directions of cutting tools are correct or not and if the rotation direction is wrong, appropriate connection must be made.

6. MACHINE SAFETY INFORMATION

6.1 Lifting, installation, electric maintenance of the machine should be carried out by qualified personnel only.

6.2 Routine maintenance and scheduled maintenance should be carried out by qualified personnel after unplugging the machine first.

6.3 Ensure that the machine has been cleaned, tested and maintained before starting to operate it.

6.4 Check the safety devices, power cable and moving parts regularly. Don't operate the machine before having replaced defective safety devices or faulty parts.

6.5 Never replace the milling cutters before unplugging first.



6.6 Keep foreign materials away from the working area of the machine, keep away from the machine's moving parts

6.7 Do not work on the machine by removing the protective parts


IMPORTANT

The safety data have been defined above. In order to prevent physical damage or damage to the equipment, please read the safety information carefully and keep the manual always in an easy accessible place.

7. OPERATION

7.1 Preparation

- 7.1.1 Degrease and dry the machine table. Especially ensure that the holding grips and handles are clean and dry.
- 7.1.2 Clean all surfaces of the machine from chip and foreign particles. Use eye glasses for protection.
- 7.1.3 This machine can process on products manufactured from rigid plastic and aluminum materials that don't include iron alloy.
- 7.1.4 Control whether cutting tool (FIGURE 4 NO.18) is inserted safely to their places.
- 7.1.5 Control cutting tools against corrosion, distortion and fractions. If cutting tools are damaged, change them.
- 7.1.6 Cutting tool must process on the part after machine is operated and cycled.
- 7.1.7 Absolutely control the direction of rotation of the saw.


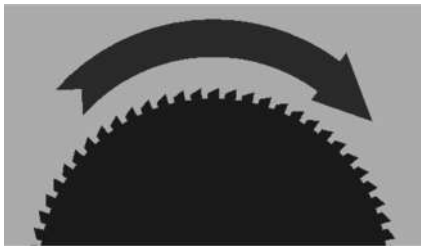


- 7.1.8 **Do not process the profile before clamping the work piece properly.**

7.1.9 Adjust the reducer speed adjustment screw (FIGURE 2 NO.11) by rotating in the direction of clockwise until providing the desired progress if the saw group cutting progress is fast. Make the opposite of the above action if the saw group cutting progress is slow.



7.1.10 While making cutting on the machine, be careful about clamps' being out of the cutting area of the saw.

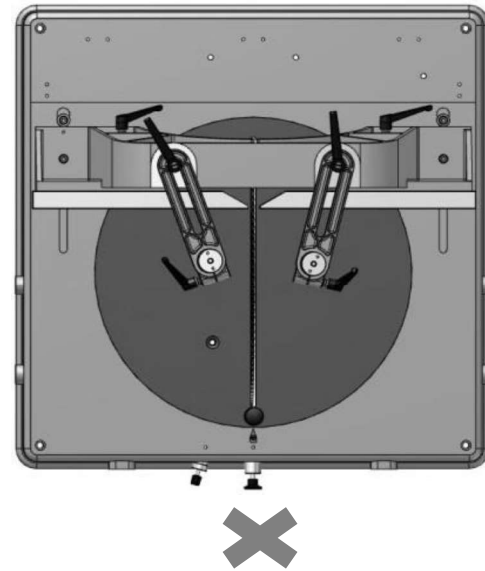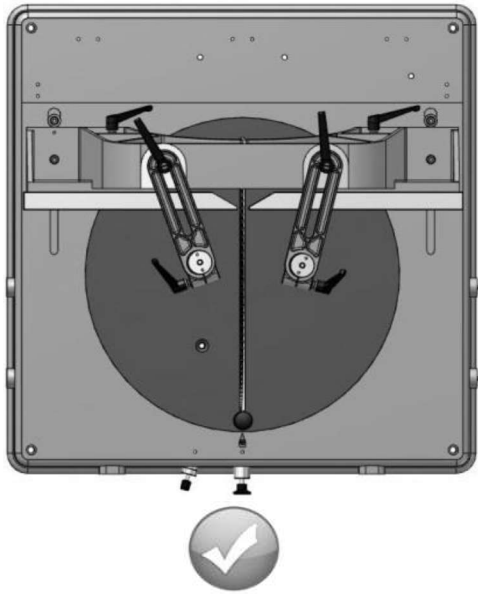

7.2 Operation

- 7.2.1 Switch the system start switch to “1” (FIGURE 1 NO.17-3)
- 7.2.2 Open the top cover (FIGURE 1 NO. 62). The top cover operates manually.
- 7.2.3 It is possible to make a straight or slanted cut on this machine. 0-15 - 22.5 - 30 – 45 - 60 and 75 degrees can be adjusted with the help of a safety catch (FIGURE 2 NO. 21), and the other interim degrees with the help of a special clamping screw (FIGURE 2 NO. 31). The safety catch is not seated in the slot in interim degrees. Tighten the clamping screw after turning the turntable to a special degree you desire.
- 7.2.4 In order to make a slanted cut pull the rod of the safety catch (FIGURE 2 NO.21) out of the slot of the safety catch. Simultaneously move the turntable (FIGURE 4 NO.1) with your other hand to a degree you want with the help of plastic handle (FIGURE 4 NO. 3). You can read the angle values with the help of a degree reader (FIGURE 2 NO.22) on the table (FIGURE 2 NO.20)
- 7.2.5 In order to provide the right or left movement of the movable setsquare (FIGURE 2 NO.41) loosen the fixing pipe (FIGURE 3 No.43) by turning half-round. Towards the right or left direction of the movable setsquare after completing the movement, provide the parallelism of the movable setsquare against each other in both of the setsquares with the help of the setscrews on the fixed setsquare (FIGURE 2 NO.40). After finishing all of the settings fix the setsquares by tightening the fixing pipes.

IMPORTANT

Distance between set screws can not be less than table channel's dimension. (Dimension of TABLE CHANNEL is 8 mm.)

- 7.2.6 If the profile to be cut is wide or high, loosen the M8 bolts (FIGURE 3 NO.51) on the square (FIGURE 2 NO.40) and move them until you reach the backstop pins (FIGURE 3 NO.28). Limit of backwards movement is 100 mm. Look at the cutting diagram for the maximum measurements and positions of the materials to be cut. Fix the square to the table by tightening the M8 bolts.

- 7.2.7 Place the PVC or aluminum profile that you will work with on the tray (FIGURE 2 NO.20). Using the clamp button (FIGURE 1 NO.17-7) located on the control Panel (FIGURE 1 NO. 17) fix the material with the clamps (FIGURE 2 No.53/56) located on the setsquare.
- 7.2.8 The vices are applied pneumatically in ACK 420 models. You can adjust the back and forth and up and down position of the vices with special clamping parts (FIGURE 2, NO.58/60/52-1/52-2). Control of pneumatic clamps is made by button (FIGURE 1 NO.17-7) on the panel (FIGURE 1 NO.17).
- 7.2.9 Close the top housing cover (FIGURE 1 NO.62). Cutting operation can not be done on the machine without closing the protection cover and the clamp on the grounds of safety.
- 7.2.10 Let the saw turn by pressing the Motor Start button (FIGURE 1 NO.17-4) on the control panel.
- 7.2.11 Provide the uplift of the saw by pressing on the double hand safety buttons (FIGURE 1 NO.17-6) at the same time. Continue to press the buttons until the part is cut off.
- 7.2.12 Remove your hand pressure on the buttons after the cutting process is completed. Cutting tool will return to the home position.
- 7.2.13 The optional cooling system can be used in the machine. In particular, when aluminum material is cut through, it is recommended to use the cooling system. You can adjust the flow rate of the coolant by using the injection valve (FIGURE 4 NO.24).
- 7.2.14 Open the cover of the upper housing (FIGURE 1 NO.62)
- 7.2.15 Take the part out by opening the vice.
- 7.2.16 Use the motor stop button to stop the saw rotation.



NOTE: Remove the pressure on the cutting buttons in a possible hazard, or press the emergency stop button. (FIGURE 1 NO.17-5)

- 7.2.17 Switch the system start switch to “0” (FIGURE 1 NO.17-3)

8. MAINTENANCE, SERVICE AND REPAIR

8.1 Maintenance

- 8.1.1 Cut the electric and pneumatic power connections of the machine.
- 8.1.2 Clean all surfaces of the machine from burs, chips and foreign substances. If the machine will not be used for a long time, lubricate undyed parts with oil that prevents rusting.
- 8.1.3 When cleaning the machine, do not use materials that may damage the dye.
- 8.1.4 Control cutting tools against corrosion, distortion and fractions. If cutting tools are damaged, change them.
- 8.1.5 Before using cutting tool, operate the machine out of gear and control whether it is inserted correctly, it is without flexure and it is inserted appropriately. Do not use cutting tools that are damaged or lost its functionality.
- 8.1.6 If the sawteeth are blunted, change a new / sharpened saw.
- 8.1.7 Sharpen with proper sharpening machines by taking the angular value of the saw into consideration.

8.2 Changing the cutting tool

- 8.2.1 Cut the electric connection of the machine.
- 8.2.2 Open the complete panel as a cover. (FIGURE 1 NO. 17).



NOTE : Make sure not to damage the components inside the cabinet.

- 8.2.3 Remove the cover (FIGURE 4 NO. 5).of the housing by removing the four Butterfly nuts (FIGURE 4 NO. 5-2) located on the saw protective enclosure (FIGURE 4 NO. 5-1).

- 8.2.4 Remove the M10 screw (FIGURE 4 NO.33) with the help of an 8 mm Allen wrench. When removing the bolt hold saw shaft (FIGURE 4 NO.7-1) from the other end with a 19 mm wrench.
- 8.2.5 Remove the string (FIGURE 4 NO.16) and saw coupling (FIGURE 4 NO.15) respectively.
- 8.2.6 Take out the saw blade (FIGURE 4 NO.18) carefully.
- 8.2.7 Install the new saw blade onto the shaft ensuring the correct rotation direction.
- 8.2.8 Install the guard group parts applying the reverse order as described above.
- 8.2.9 It is necessary to sharpen / replace the saw blade in certain intervals depending on the cutting material. If the cut material leaves burr after the cutting operation or if the saw blade is strained, it needs to be sharpened / replaced.
- 8.2.10 When replacing the saw blade, use the part of the blade washer which is appropriate for the blade shaft diameter. The outer diameter of the blade washer is 30 and 32 mm.
- 8.2.11 **During saw blade change operations, use protective gloves.**
- 8.2.12 **Saw must be selected according to standart DIN EN 847-1.**
- 8.2.13 **A saw blade rotating in reverse direction, causes danger both for the operator and the equipment. The teeth of the saw blade would be damaged and even broken.**



8.3 Changing the belt

- 8.3.1 Cut the electric connection of the machine.
- 8.3.2 Dismantle the Saw by applying the saw replacement process (Clause 8.2).
- 8.3.3 After taking the saw out, put the saw somewhere in the casing of the machine or take it out by removing saw housing connection screws (FIGURE 4 NO.27).
- 8.3.4 Take out the connection screws (FIGURE 4 NO.26) of the belt housing (FIGURE 4 NO.13) by removing them.
- 8.3.5 Loosen the motor connection bolts (FIGURE 4 NO.31) with the wrench.
- 8.3.6 Provide the slackening of the belt by pushing the Motor (FIGURE 4 NO.12) upwards.
- 8.3.7 Change the new belt with the previous one. Be careful when fixing the belt to the channels of balancing wheel (FIGURE 4 NO.20) of the channels of the belt.
- 8.3.8 After placing the new belt in its seat, arrange tensioning of the belt by turning belt tensioning part (FIGURE 4 NO.7-2) with the help of 8 mm Allen wrench. After you set to the appropriate tension, tighten the motor connection bolts (FIGURE 4 NO.31) with your unused hand without leaving the part.
- 8.3.9 Fix the removed parts by following the reverse sequence that your removed them before.


8.4 Angular and run out adjustment control of saw blade and set square

- 8.4.1 Cut the electric connection of the machine.
- 8.4.2 Control the run out of the saw blade with eyes. If possible use a dial gage.

8.4.3 If there is any problem in the inclined cut, control the saw's 90 degrees orthogonal to the set square with the aid of the set-square. If it is not proper, loosen the stay bolt at the top which tightens the spring (FIGURE 2 NO.83) Have the pin located to its place by turning the spring in way that it can provide it to be proper by setting it to the 90 degrees. Tighten the screw at the top again which fastens the spring.

8.5 Adjust the air pressure (pneumatic systems)

- 8.3.1 Pull up pressure adjustment valve. Set adjustment valve to the desired value on manometer by turning it clockwise or counter clockwise. Then lock the valve by pressing it down.
- 8.3.2 Set the air pressure between 6 and 8 BAR. If air pressure drops below the stated values, accessories operating with pneumatic power do not work.
- 8.3.3 Conditioner unit accumulates the water in the air in the collection container so that it won't damage pneumatic components. At the end of the working day, empty the accumulated water by opening water discharge valve under the collection container.
- 8.3.4 In order to put oil to the oil tank, remove the reservoir by turning. Oils recommended by the manufacturer are; TELLUS C10 / BP ENERGOL HLP 10 / MOBIL DTE LIGHT / PETROL OFİSİ SPINDURA 10.

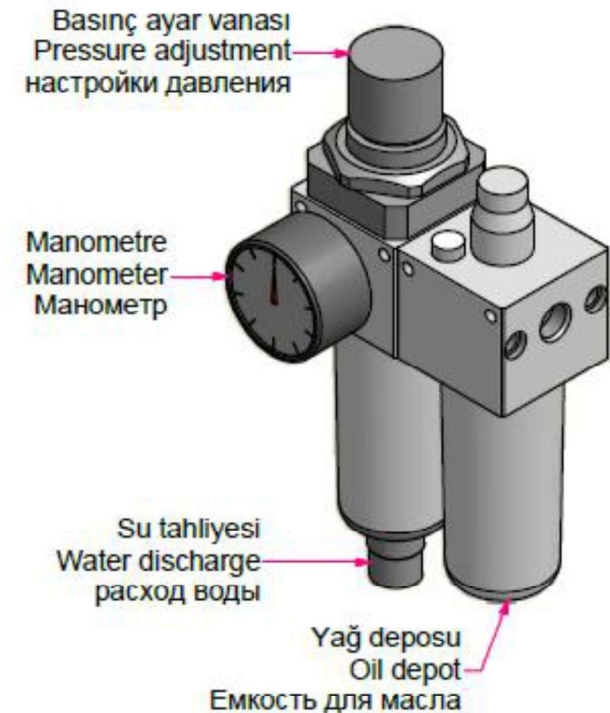

9. NOISY EMISSION VALUES

Material	Aluminium	LwA	98 dB (Measured Value)
Lenght	1220 mm.	LpA	93 dB (Average Sound Pressure Value)
Width	70 mm.	K	2 dB (Uncertainty in the Measurements)
Height	20 mm.		
<p>The values given for the noise are the emission level and it does not show that it is in the safe working level. A connection between emission and exposure levels is available, however it is not used confidently for the determination whether these more advanced precautions are necessary or not. The factors that affect the real level of exposure, affecting the working power, are residence time, features of working place, in other words other noise resources, actions on other side and the number of the machines. Furthermore, the exposure level given permission can change from country to country. This informing, however, provides the machine user to evaluate the hazard and risks well.</p>			
Machine Characteristic Information		Saw Characteristic Information	
Rotation Speed of Saw	2850 rpm	Saw Size	420 mm
Motor Power	2.2 kW	Saw Thickness	4 mm
Nominal Voltage	400 V	Saw Shaft Thickness	3.2 mm
		Saw Progress Speed	65 / sn. (Aluminium material)

10. TROUBLESHOOTING GUIDE

Here are some recommendations for solving urgent problems. If the trouble cannot be solved, or if you have a problem other than those described hereunder, please contact our technical service or your nearest dealer.

TROUBLE	CAUSES	REMEDY
<p>Low surface quality (at aluminum and similar materials) :</p> <p>Rough surface,</p> <p>Large chip,</p> <p>Not homogenous surface,</p> <p>Saw blade traces visible</p>	<p>Not cooling the saw blade surfaces</p>	<p>Lubricating the saw blade cutting surfaces,</p> <p>Using of cooling liquid</p>
	<p>Using of damaged or blunt saw blade</p>	<p>Check the saw blade teeth. Replace if necessary.</p>
	<p>Saw blade moves to quick</p>	<p>The cutting speed is too high for the material. Decrease the cutting speed.</p>
<p>Motor does not work (Start button is pressed, not working)</p>	<p>No power supply to the machine.</p>	<p>Check the electric cable connections.</p> <p>Check the electric power sockets.</p>
<p>Motor is working but the pneumatic clamp pistons do not work.</p>	<p>The air supply connections are missing, or the air pressure is too low.</p>	<p>Check the air compressor connections.</p> <p>Adjust the air pressure between 6-8 Bar on the conditioner.</p>
<p>The saw blade rotates in reverse direction.</p>	<p>The electric connection, the power cable or the connection at the panel is wrong.</p>	<p>Let the electric connections carry out by a qualified electrician.</p>

11. WARRANTY CONDITIONS

YILMAZ Machine Industry and Trade Limited Company, guarantees that all machines have been tested and conform to the international standards.

The guarantee is valid 24 months from despatch date and does not cover the electrical parts of the machine.

During this period:

- Any repair and replacement effected at our workshop is completely free of charge (only transport costs are at customer's charge).
- For repair and replacement effected by our technician at the customer's site, we will invoice only the travel and lodging costs for our technician.

The guarantee does not cover damages caused by:

- not respect of the rules indicated in the manual instruction book
- not correct voltage
- improper use or use not in accordance with what the Machine has been designed for
- use of non original tooling
- programming errors
- lack of cleaning and of ordinary maintenance by the customer
- transport or displacement (even inside the workshop)
- natural events (lightings, fires, floods)

The warranty does not cover, in any case, damages caused by the malfunction of the Machine